

Operating Manual
Handheld Pressure-Meter
water-proof

as of version 1.0

GMH 5130

-  Please carefully read these instructions before use!
-  Please consider the safety instructions!
-  Please keep for future reference!



WEEE-Reg.-Nr. DE 93889386

Index

1	GENERAL NOTE	3
2	SAFETY	3
2.1	INTENDED USE.....	3
2.2	SAFETY SIGNS AND SYMBOLS.....	3
2.3	SAFETY GUIDELINES	3
3	PRODUCT SPECIFICATION.....	4
3.1	SCOPE OF SUPPLY	4
3.2	OPERATION AND MAINTENANCE ADVICE	4
4	HANDLING	5
4.1	DISPLAY ELEMENTS.....	5
4.2	PUSHBUTTONS	5
4.3	CONNECTIONS	5
4.4	POP-UP CLIP	6
5	START OPERATION.....	7
6	CONFIGURATION	7
7	REMARKS TO SPECIAL FEATURES	8
7.1	DIFFERENT PRESSURE UNITS	8
7.2	DIFFERENT KINDS OF MEASURING.....	8
7.3	WATER DEPTH / LEVEL MEASUREMENT.....	9
7.4	SEA-LEVEL CORRECTION FOR ABSOLUTE PRESSURE SENSORS.....	9
7.5	AVERAGING FUNCTION.....	9
8	OUTPUT	10
8.1	INTERFACE.....	10
9	INPUT ADJUSTMENT	10
10	PRESSURE CONNECTION TO THE SENSORS.....	11
11	ACCURACY CHECK / ADJUSTMENT SERVICE	11
12	REPLACING BATTERIES.....	11
13	ERROR AND SYSTEM MESSAGES	12
14	RESHIPMENT UND DISPOSAL	12
14.1	RESHIPMENT	12
14.2	DISPOSAL INSTRUCTIONS.....	12
15	SPECIFICATIONS.....	13

1 General Note

Read this document carefully and get used to the operation of the device before you use it. Keep this document within easy reach near the device for consulting in case of doubt.

Mounting, start-up, operating, maintenance and removing from operation must be done by qualified, specially trained staff that have carefully read and understood this manual before starting any work.

The manufacturer will assume no liability or warranty in case of usage for other purpose than the intended one, ignoring this manual, operating by unqualified staff as well as unauthorized modifications to the device. The manufacturer is not liable for any costs or damages incurred at the user or third parties because of the usage or application of this device, in particular in case of improper use of the device, misuse or malfunction of the connection or of the device.

The manufacturer is not liable for misprints.

2 Safety

2.1 Intended Use

This device must only be used with one "GMSD... - K51" or "MSDE" pressure sensors. Other usages are not intended.

The safety requirements (see below) have to be observed.

The device must be used only according to its intended purpose and under suitable conditions.

Use the device carefully and according to its technical data (do not throw it, strike it, ...)

Protect the device from dirt.

2.2 Safety signs and symbols

Warnings are labeled in this document with the followings signs:



Caution! This symbol warns of imminent danger, death, serious injuries and significant damage to property at non-observance.



Attention! This symbol warns of possible dangers or dangerous situations which can provoke damage to the device or environment at non-observance.



Note! This symbol point out processes which can indirectly influence operation or provoke unforeseen reactions at non-observance.

2.3 Safety guidelines

This device has been designed and tested in accordance with the safety regulations for electronic devices. However, its trouble-free operation and reliability cannot be guaranteed unless the standard safety measures and special safety advises given in this manual will be adhered to when using the device.

1. Trouble-free operation and reliability of the device can only be guaranteed if the device is not subjected to any other climatic conditions than those stated under "Specification".

If the device is transported from a cold to a warm environment condensation may cause in a failure of the function. In such a case make sure the device temperature has adjusted to the ambient temperature before trying a new start-up.

2.  If there is a risk whatsoever involved in running it, the device has to be switched off immediately and to be marked accordingly to avoid re-starting.
Operator safety may be a risk if:
 - there is visible damage to the device
 - the device is not working as specified
 - the device has been stored under unsuitable conditions for a longer time.
 In case of doubt, please return device to manufacturer for repair or maintenance.
3. When connecting the device to other devices the connection has to be designed most thoroughly as internal connections in third-party devices (e.g. connection GND with protective earth) may lead to undesired voltage potentials that can lead to malfunctions or destroying of the device and the connected devices.
-  This device must not be run with a defective or damaged power supply unit.
Danger to life due to electrical shock!
4.  Do not use these products as safety or emergency stop devices or in any other application where failure of the product could result in personal injury or material damage.
Failure to comply with these instructions could result in death or serious injury and material damage.
5.  This device must not be used at potentially explosive areas! The usage of this device at potentially explosive areas increases danger of deflagration, explosion or fire due to sparking.
6.  This device is not constructed for use in medical applications.

3 Product Specification

3.1 Scope of supply

- device with 2 AAA batteries
- Operation manual
- Short form manual

3.2 Operation and maintenance advice

1. Battery operation:

If 'bAt' is shown in the lower display the battery has been used up and needs to be replaced. However, the device will operate correctly for a certain time. If 'bAt' is shown in the upper display the voltage is too low to operate the device; the battery has been completely used up. Battery change: p.r.t. chapter 12.



The battery has to be taken out, when storing device above 50 °C.
We recommend taking out battery if device is not used for a longer period of time.
After recommissioning the real-time clock has to be set again.

2. Mains operation



The output voltage of a connected power supply unit has to be between 4.5 and 5.5 V DC.
Don't apply overvoltage!

3. Treat device and sensor carefully. Use only in accordance with above specification. (do not throw, hit against etc.). Protect plug and socket from soiling.

4. Connecting/changing sensors



Use only sensors of GMSD ... - K51 or MSD - series!
Other sensors may lead to damage to the device and the sensor.

Switch off device before changing the sensor.


The sensors are coupled to the instrument via bayonet connectors

To connect a sensor, plug in the connector in the right position and then rotate the ribbed ring ½ turn.

To disconnect rotate the ribbed ring ½ turn and then pull out the connector.


4 Handling

4.1 Display elements

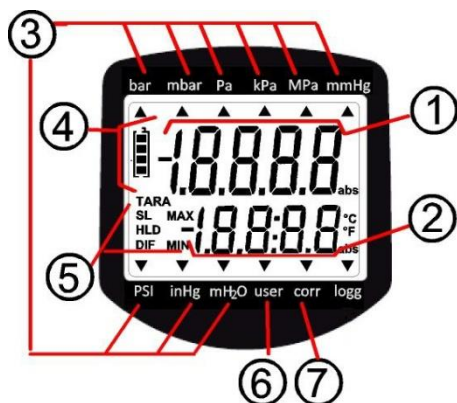

- | | | |
|---|--|---|
| 1 | Main display: | measuring value |
| 2 | Secondary display: | display of minimum / maximum / memorized measuring value |
| 3 | Arrows for selected measuring unit | |
| 4 | Rating of battery status | |
| 5 | Display elements to show minimum / maximum / memorized measuring value as well as tare-function and sea-level-correction | |
| 6 | user arrow: | measuring value is shown in freely adjustable user-unit (please refer to chapter 7.1) |
| 7 | corr arrow: | zero-point or slope correction is active |

4.2 Pushbuttons

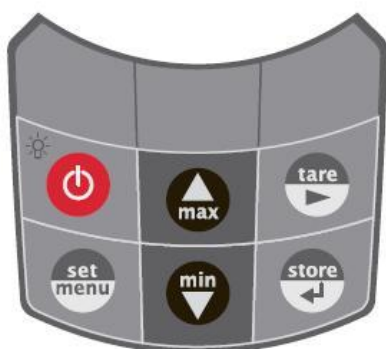

On / off key, backlight

press shortly: activate backlight or switch on instrument
press longer: switch off instrument



set / menu:

press for 2 sec. (menu): invoke configuration menu



min / max:

press shortly: min. or max. value is displayed
press for 2 sec: the corresponding value is deleted



press shortly: tare-function: display is set to 0. All measuring values are displayed relatively to this set tare-value from now on.
press for 2 sec: deactivate tare-function



store / enter:

hold and save current measuring value ('HLD' is displayed)
(Set/Menu: confirm settings, return to measuring)

4.3 Connections




Universal output: interface, supply, analog output (p.r.t. chapter 8)

7-pole bayonet connector: connection for sensor

4.4 Pop-up clip


Handling:

- Pull at label “open” in order to swing open the pop-up clip.
- Pull at label “open” again to swing open the pop-up clip further.

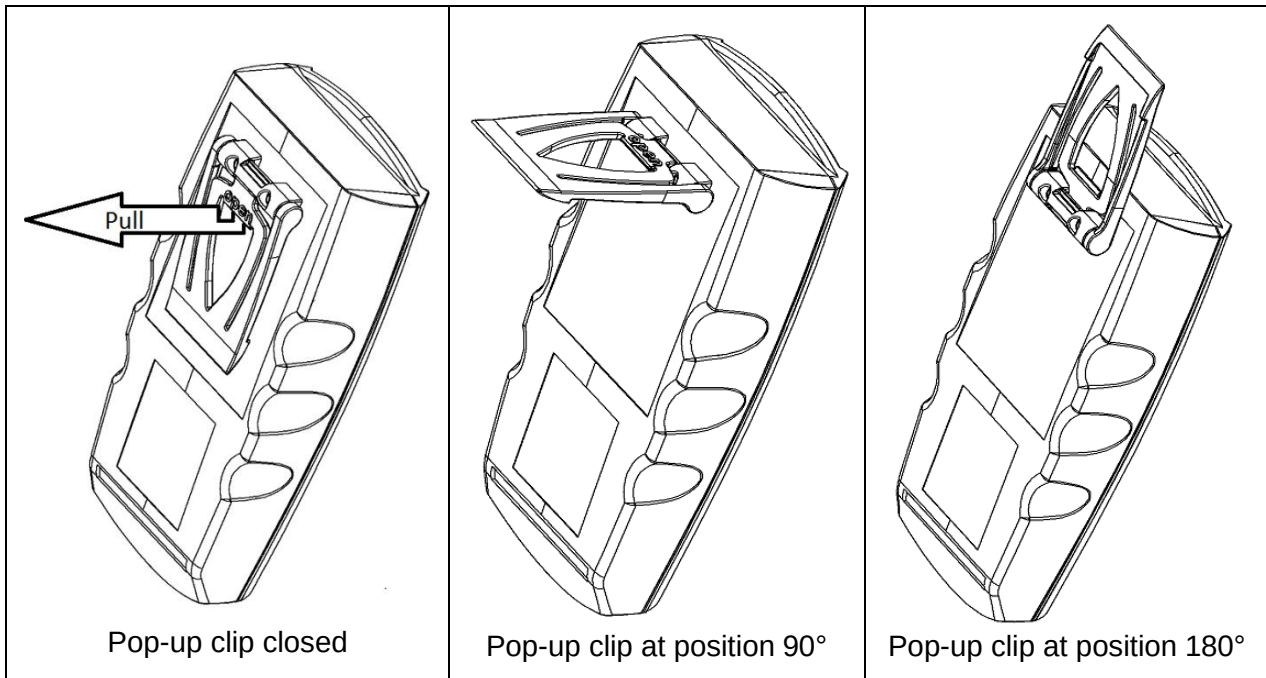

Function:

- The device with a closed pop-up clip can be plainly laid onto a table or attached to a belt, etc.
- The device with pop-up clip at position 90° can be set up on a table, etc.
- The device with pop-up clip at position 180° can be suspended from a screw or the magnetic holder GMH 1300.

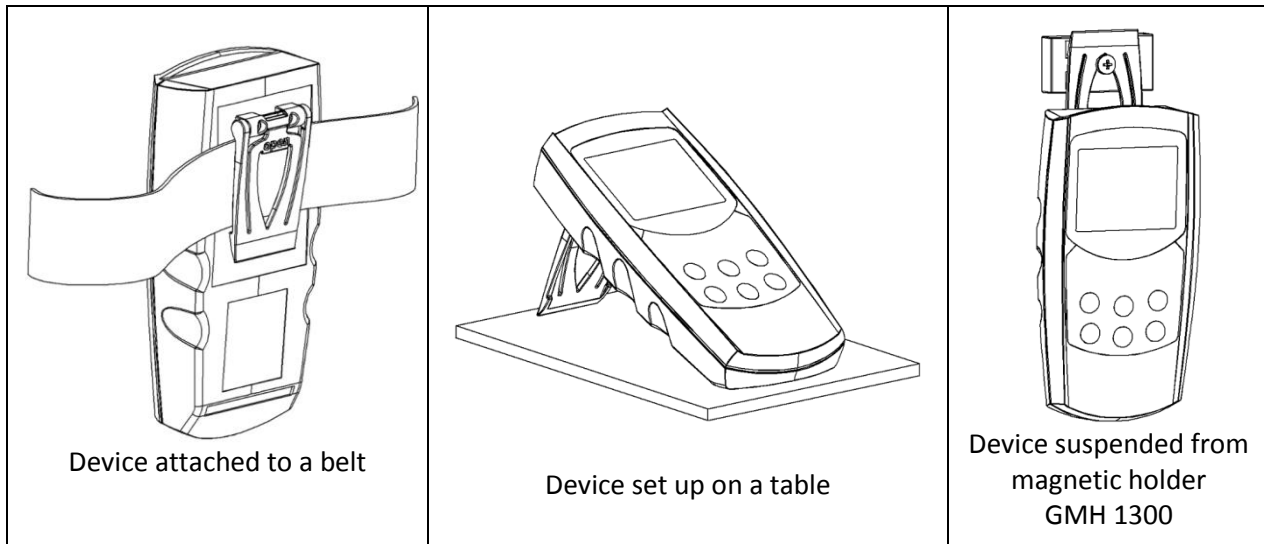

5 Start Operation

Connect sensors, turn device on via  key.



After segment test the device displays some configuration:

-  if standard measurement is selected
-  if fast measurement is selected
-  if peak value detection is selected

After that the device is ready for measuring.

6 Configuration



Some menu points depend on current device settings.

To change device settings, press “**menu**”  for 2 seconds. This will activate the configuration menu (main display: “SEt”). Pressing “**menu**”  changes between the menus points, pressing  jumps to the referring parameters, which can be selected with key .

The parameters can be changed with  or .

Pressing “**menu**”  again jumps back to the main configuration menu and saves the settings.

“**enter**”  finishes the configuration and returns to standard measuring operation.



Pressing “**menu**” and “**store**” at the same time for more than 2 seconds will reset the device to factory defaults.

If no key is pressed for more than 2 minutes the configuration will be aborted. All changes will not be saved!

Menu	Parameter	Value	Description	
		 or 		
	Set Configuration: General configurations			
	Unit	Unit: Select measuring unit		**
	Arrow to bar , mbar ...	Measuring value is displayed in corresponding unit, the selectable units depend on connected sensor		
	Arrow to “ user ”	Measuring value is displayed in freely adjustable user-unit		
	bASe user	bar, mbar	Unit “user”: base unit	
	dP user	0000, 000.0,0000	Unit “user”: decimal point setting (only if user-unit selected)	
	FACt user	-19999...19999	Unit “user”: multiplication factor	
	SL	Sea Level: Sea-level correction		**
	oFF	Sea-level correction off		
	on	Sea-level correction on (<i>p.r.t. 7.4</i>)		
	ALt	-2000 ... 9999	Sea-level in [m]	**
	rAlE	Rate: Measuring rate		
	Slo	Slow measuring rate (4 Hz filtered, low power consumption)		
	FASt	Fast measuring rate, filtered (1000 Hz)		
	P.dEt	Peak detection: fast measuring rate, unfiltered (1000 Hz)		

	t.AVG	Averaging Filter		
		1 ... 120	Averaging period in seconds	
		oFF	Averaging function is deactivated	
	P.oFF	Auto Power-Off: Select power-off delay		
		1 ... 120	Power-off delay in minutes. Device will be automatically switched off as soon as this time has elapsed if no key is pressed/no interface communication takes place.	
		oFF	Automatic power-off function deactivated (continuous operation)	
	L.iTE	Background illumination		
		oFF	Illumination deactivated	
		5 ... 120	Turn off illumination after 5 ... 120s (factory settings: 5 s)	
		on	Illumination always on	
Set Out	Set Output: Universal output adjustments			
	Out	oFF	Interface and analog output off	
		SEr:	Serial interface activated	
	Adr.	01, 11..91	Base address for serial interface communication (only at Out = SEr)	
Set Corr	Set Corr: Input adjustment			
	OFFS	Zero adjustment/offset of sensors		
		oFF	No zero adjustment of sensors	
		Sensor dep. e.g. -5.00..5.00 mbar	The offset of sensor will be displaced by this value to compensate for deviations of the probe or of the measuring device.	
	SCAL	Slope adjustment of sensors		
		oFF	No slope adjustment of sensor	
		-2.000 ... 2.000	The slope of sensor will be changed by this factor [%] to compensate deviations of probe or measuring device	

(**) *Parameter can only be called if corresponding sensor is plugged.*

7 Remarks to Special Features

7.1 Different Pressure Units

Depending on the connected sensors different units can be selected via menu (Unit). The measuring range of the sensors may restrict the choice!

User-Unit

For pressure units, which are not covered by the ones printed on the display, there can be done a manual setting for a "user-defined" unit.

Example:

To enable a GMSD 2 BR - K51 (-1000 ... 2000 mbar) to display the unit kg/cm², following settings (bold) have to be entered:

	kg/cm ²	Torr	atm	at	
bASE user:	bar	mbar	bar	bar	
DP user:	.0000	.0000	.0000	.0000	
FACT user:	1.0197	.7433	0.9869	1.0197	

7.2 Different kinds of measuring

Three different kinds of pressure measuring are supported. Two of them (P.dEt and FASt) are working with high measuring frequency of more than 1000 measurings per second.

7.2.1 Standard measuring (slow)

rAtE
SLo

Measuring rate 4 Hz, averaging and filter functions are active.

Application: Measuring of slowly changing or static pressures, e.g. measuring of leakproofness, atmospheric pressure...

Highest accuracy, high noise immunity, low power consumption.

7.2.2 Peak detection (Peak detection)

rAtE
P.dEt

Measuring rate >1000 Hz, the value is displayed unfiltered.

Application with logger function: Measuring of short pressure peaks or fast changing pressures with a resolution of <1 ms. The cyclic logger function records the arithmetic mean value, the highest and the lowest peak of the referring time interval.

Attention: higher power consumption, measuring is sensitive to noise (EMI, ...).



Measuring is sensitive to noise (EMI, ...) and higher power consumption.

7.2.3 Fast filtered measuring (fast)

rAtE
FAST

Measuring rate >1000 Hz, but the value is filtered (higher noise immunity than P.dEt, small peaks will be filtered out), apart from that identical behavior like rAtE-P.dEt.

7.3 Water depth / level measurement



Water-proof sensors have to be used for water depth / level measurement.

Select the unit [m] for meters water column (selection mH₂O) in menu "Unit". 10 m water column (=water depth) corresponds roughly 1 bar overpressure.

Measurements can be made e.g. like described below: (for abs. pressure sensors SL has to be deactivated)

- With an abs. pressure sensor: Press 'Tara' when sensor is at ambient air and then bring sensor to the depth to be measured. The display shows now the depth in [m].
- With a rel. pressure sensor: bring tube connection for lower press. in contact to ambient air by means of a tube (no water contact!) and bring the sensor with its open pressure connection for higher pressure to water depth to be measured (display and is compensated for pressure changes in ambient air).

7.4 Sea-level correction for absolute pressure sensors

The device displays the absolute pressure. This is not necessarily the same like the values given by weather stations! The weather stations are displaying the pressure at sea level. Usually the sensor is placed above sea level and therefore the pressure loss resulting from the actual level above sea level has to be considered, if the value at sea level (zero) should be measured! To correct the measuring display, activate the "Sea-Level-Function" (SL, p.r.t. chapter 0, setting is only possible, if an abs. pressure sensor is connected). Then enter the altitude above sea level of the sensor's location in meters (Alti, p.r.t. chapter 6). When activated, the display shows the SL-arrow and the device displays the pressure value at sea level.

7.5 Averaging function



The averaging function concerns the display values (LCD and interface).

The averaging integrates the measuring values during a selectable period of time and then calculates the average display value. It is independent from the selected kind of measuring (slow, fast, peak detect).

As long as not enough values have been collected (i. e. for the selected averaging time) to calculate an average value, the upper display shows "----", the lower display a 'countdown'.

Function of min/max-value memory during averaging:

- If averaging is activated and slow measuring is selected (rAtE-SLo), the min-/max-value memory refers to the average display value.
- If averaging is activated and fast measuring is selected (rAtE-FAST or P.dEt), the min-/max-value memory refers to the internal measured values (fast peaks can be detected).

8 Output

The output can be used as serial interface (for USB 5100 interface converter).

If the output is not needed, it is strongly recommended to deactivate it (Out oFF) to lower power consumption. This increases battery life time.

If the device is used together with interface adapter USB 5100 the device is supplied from the interface.

Pin assignment:



1: external supply +5V, 50 mA

2: GND

3: TxD/RxD (3.3V Logic)

4: not used



Only suitable adaptor cables are permitted (accessories)!

8.1 Interface

The device can be connected to a USB interface of a PC by the electrically isolated interface converter USB 5100 (accessory). The data is transmitted binary-coded and protected against transmission errors by complex safety mechanism (CRC).

The following standard software packages are available:

- **GSOFT3050:** Operating and evaluation software for the integrated logger function
- **EBS20M / -60M:** 20-/60-channel software for measuring value display
- **GMHKonfig:** Configuration Software (for free on internet)

In case you want to develop your own software we offer a **GMH3000-development package** including:

- a universally applicable Windows functions library ('GMH3x32e.DLL') with documentation, can be used by all 'established' programming languages, suitable for:
Windows XP™, Windows Vista™, Windows 7™
- Programming examples Visual Basic 4.0™, Delphi 1.0™, Testpoint™ etc.

The device has 3 channels:

- Channel 1: current measuring value (sensor 1) and base address
- Channel 2: min peak
- Channel 3: max peak



The measuring-/ alarm- and display range values read back from the interface are always in the selected measurement unit (mbar, bar...)!

9 Input Adjustment

The zero point and slope of each measuring inputs can be adjusted with the parameters offset ("OFFS") and scale ("SCAL").

A reasonable adjustment presumes reliable references (e.g. ice water, controlled precision water bath, etc.).

If the inputs are adjusted (i.e. offset and scale are different from default settings) the device will shortly display "Corr" after turned on.

Default setting for offset and scale are 'off' = 0.0, i.e. inputs are not changed.

Zero point correction:

$$\text{Displayed value} = \text{measured value} - \text{OFFS}$$

Zero point and slope correction:

$$\text{Displayed value} = (\text{measured value} - \text{OFFS}) * (1 + \text{SCAL} / 100)$$

10 Pressure Connection to the Sensors

The device is designed to be connected to the sensors of the GMSD/GMXD...-series without a new calibration being necessary. Therefore a great variety of replaceable sensors of e.g. -1.999 ... 2.500 mbar relative up to 0 ... 1000 bar absolute pressure can be connected to the device.

Relative pressure sensors (types: GMSD ... MR - K51, GMSD ... BR - K51)

- **For measurements of over- or under pressure:**

Pressure sensors GMSD 2,5 MR - K51, GMSD 25 MR - K51 and GMSD 350 MR - K51 allow for measurements of under pressure up to the entire over pressure measuring range by re-plugging the tube to pressure port "A".

Please note that all values are displayed as positive values. No minus sign will be shown. (Example for GMSD 25 MR - K51: For tube connection "B" the measuring range covers -19.99 to 25.00 mbar. If you replug to port "A" under pressure measurements down to -25.00 mbar could be carried out with the display showing the value 25.00 (no minus sign).

- **For measurements of pressure differences:**

Connect both plastic tubes with an internal diameter of 4 mm to pressure port "B" and "A"; make sure to apply higher pressure to port "B".

Absolute pressure sensors (types: GMSD ... BA - K51)

Connect plastic tube with an inner diameter of 4 mm to pressure port "A". (Port "B" is not used.)

Stainless steel sensors (types: MSD ... MRE, MSD ... BRE, MSD ... BAE)

For measurements of over-, under- or absolute pressure screw sensor to G1/2" pressure terminal or plug plastic tube to a suitable adapter. Connection to instrument: Use cable MSD-K51.

11 Accuracy Check / Adjustment Service

You can send the device to the manufacturer for adjustment and inspection.

Calibration certificate - DKD certificate - official certifications:

If the measuring instrument is supposed to receive a calibration certificate, it has to be sent to the manufacturer (declare test points).

If the device is certificated together with a suitable sensor very high overall accuracies are possible.

Basic settings can only be checked and – if necessary – corrected by the manufacturer.

A calibration protocol is enclosed to the device ex works. This documents the precision reached by the production process.

12 Replacing Batteries

Before changing batteries, please read the following instruction and follow it step by step.

 
Not following the instruction may cause harm to the instrument or the protection against ingress of water and dust may be lost!

Avoid unnecessary opening of the instrument!

1. Open the 3 Phillips screws at the backside of the instrument.
2. Lay down the still closed instrument, so that the display side points upwards.
The lower half of the housing incl. the electronics should be kept lying down during battery change.
This avoids loss of the sealing rings of the screw holes..
3. Lift upper half of housing. Keep an eye on the six function keys, to be sure not to damage them.
4. Change carefully the two batteries (Type: AAA).
5. Check: Are the 3 sealing rings placed in the housing?
Is the circumference seal of the upper half sound and clean?
6. Close the housing, taking care that it is positioned correctly, otherwise the sealing may be damaged. Afterwards press the two halves together, lay the instrument with display pointing downwards and screw it together again
Take care to screw only until you feel increasing resistance, higher screwing force does not result in higher water protection!



13 Error and System Messages

Display	Description	What to do?
	No sensor connected	Switch off device and connect sensor
	Connected sensor or device defective	If 2nd sensor available, check if device is ok. Return defective device/sensor to manufacturer for repair
	Value extremely out of measuring range	Check: pressure not within sensor range?
No display or confused characters, device does not react on keypress	Battery empty	Replace battery
	Mains operation: wrong voltage or polarity	Check power supply, replace it when necessary
	System error	Disconnect battery and power supplies, wait shortly, then reconnect
	Device defective	Return to manufacturer for repair
Err.1	Measured value above allowable range	Check: pressure not within sensor range? -> measuring value too high!
	Sensor defective	Return to manufacturer for repair
Err.2	Measured value below allowable range	Check: pressure not within sensor range? -> measuring value too low!
	Sensor defective	Return to manufacturer for repair
Err.3	Display range overflow	Check: value above 19999 -> too high to be displayed
Err.4	Display range underflow	Check: value below -19999 (Tara?) -> too low
Er.11	Value could not be calculated	Choose different unit
	Calculation overflow happened	Choose different unit
Err.7	System error	Return to manufacturer for repair
-----	Sensor not present / recognised	reconnect sensor, during logging: stop the logger and restart it
	could not calculate value	suitable sensor / unit combination necessary

If “bAt” is flashing, the battery will be exhausted soon. Further measurements are possible for short time. If “bAt” is displayed continuously the battery is ultimately exhausted and has to be replaced. Further measurements aren't possible any more.

14 Reshipment und Disposal

14.1 Reshipment



All devices returned to the manufacturer have to be free of any residual of measuring media and/or other hazardous substances. Measuring residuals at housing or sensor may be a risk for persons or environment



Use an adequate transport package for reshipment, especially for fully functional devices. Please make sure that the device is protected in the package by enough packing materials.

14.2 Disposal instructions



Batteries must not be disposed in the regular domestic waste but at the designated collecting points.

The device must not be disposed in the unsorted municipal waste! Send the device directly to us (sufficiently stamped), if it should be disposed. We will dispose the device appropriately and environmentally sound.

15 Specifications

Display range		maximal -19999...19999 digit, depends on used sensor
Number of channels		1
Suitable probes		GMSD ... - K51 and MSD ... sensors with connection cable MSD-K51
Available ranges / resolutions		ranging from -1.999 ... 2.500 mbar / 0.001 mbar to 0.0 ... 1000 bar / 1 bar
Connections	sensor	7-pole bayonet connector
	output / ext. supply	4-pole connector for serial interface and supply (USB Adapter USB 5100)
Display units		depends on meas. range selection (depends on connected sensor): mbar, bar, Pa, kPa, MPa, mmHg, inHg, PSI, mH ₂ O
User unit		freely adjustable
Measuring frequency		4 / s or 1000 / s
Accuracy		± 0.1 % FS ± 1 digit
Working conditions		-25 ... 50 °C; 0 ... 95 %RH (non condensing)
Storage conditions		-25 ... 70 °C
Display		4 ½ digit 7-segment display, illuminated (white)
Correction function		offset / slope (via menu), if offset/slope value not equal zero: "corr" is displayed
Additional functions		min- / max- / hold- function
Averaging		adjustable, 1 ... 120 seconds
Housing	protection class	IP65 and IP67
	dimensions L*W*H [mm]	160 * 86 * 37 incl. protective covering
	weight	approx. 250 g incl. batteries and protective covering
Power supply		2*AAA-batteries (included in delivery)
	current consumption	2.0 mA (at Out = Off, equivalent to 500 h), illumination ~10mA (turns off automatically)
Battery-change indicator		automatically if battery exhausted "bAt", warning "bAt" flashing
Auto-off-function		Device will be automatically switched off if no key is pressed/no interface communication takes place for the time of the power-off delay. The power-off delay can be set to values between 1 and 120 min.; it can be completely deactivated.
Directives / standards		The instruments confirm to following European Directives: 2014/30/EU EMC Directive 2011/65/EU RoHS Applied harmonized standards: EN 61326-1 : 2013 emissions level: class B emi immunity according to table 3 and A.1 Additional fault: <1% EN 50581 : 2012

